CRITICAL INSTRUCTIONS

Application: Land Rover/Ford Transit 2.2/2.4/2.5LD

Part Number: 49131-05403 49531-05403/05403E 49531-05313/05313E 752610-5032S/0032E 767933-5015S/0015E 787556-5022S 854800-5001S 752610-5035S/0035E

WHEN FITTING THIS TURBO, IT IS **CRITICAL** THE FOLLOWING INSTRUCTIONS ARE ADHERED TO:

Replace Oil Strainer and Oil Feed Pipe

The sump should be removed and cleaned, then a new oil strainer and oil feed pipe fitted. After 100 miles, change the oil and filter.

The oil feed system to the turbocharger has a tendency to become restricted over time. Most failures of this turbocharger are caused by abrasives in the oil which collect in the system. Performing the above actions will minimise the risk of the new turbocharger being damaged.

Note: from data received, we have seen an increase in returned turbochargers with this issue.

Any questions regarding the above should be directed to the supplier of this unit before commencing any work

